
AutoInspect.ae

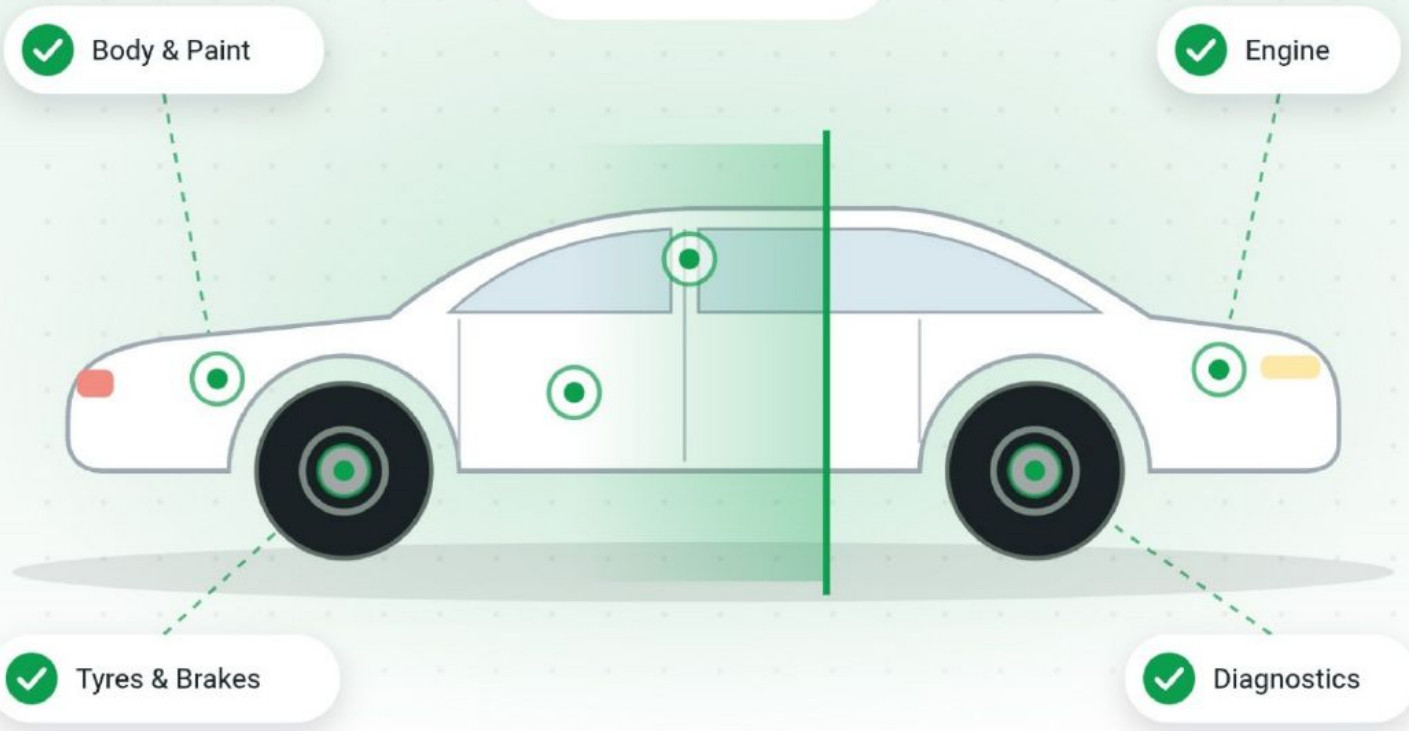

130+ POINTS

Comprehensive Inspection Report

www.autoinspectuae.com

Toyota Land Cruiser Prado 2020

VIN JTEBU3FJ8LK

REPORT ID AI-261101-F492

Call us
+971 56 747 2581

Website
www.autoinspectuae.com

Inspection Details

Report ID **AI-261101-F492**

Date	Time	Inspection Type	VIN Number
02-NOV-2026	12:23 AM	130+ Points	JTEBU3FJ8LK1

SCAN FOR SUMMARY

Vehicle Summary

Toyota Land Cruiser Prado 2020




Make	Toyota
Model	Land Cruiser Prado
Model Year	2020
Regional Specs	GCC
Transmission	Automatic
Engine Size	6 cylinder
Odometer	Genuine
Spare Tyre	Available
Number of Keys	1
Vehicle Type	SUV
External Colour	White

Odometer Reading	Fuel Type
156,764 km	Petrol

Report Overview

Pass 94% Defect 6%

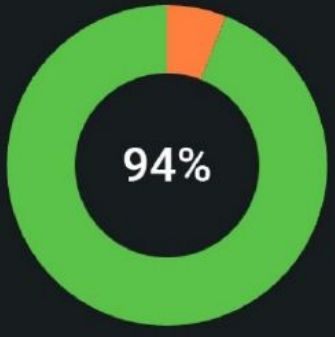


Items needing attention

Front bumper Body	REPAINTED	Rear bumper Body	REPAINTED
Front left fender Body	REPAINTED	Front left door Body	REPAINTED
Rear left door Body	REPAINTED	Rear left fender Body	REPAINTED

Tyres & Rims

5 tyres & rims checked

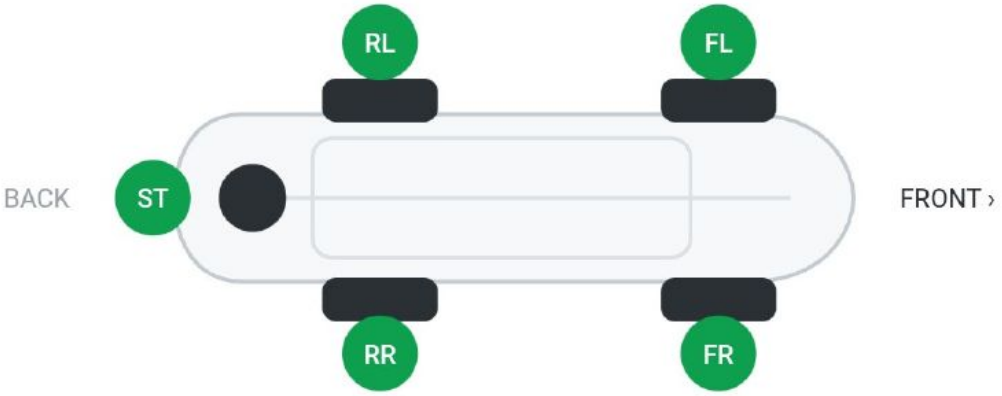

Front Left (FL)

PASS

Rim PASS

Manufacturing year
2024



Rear Left (RL)

PASS

Rim PASS

Manufacturing year
2025



Rear Right (RR)

PASS

Rim PASS

Manufacturing year
2024



Front Right (FR) PASS

Rim PASS

Manufacturing year
2024



Spare Tyre (ST) PASS

Rim PASS



Brake

4 wheels checked



Front Left (FL)

Brake Type
DISC


PADS PASS DISC PASS



Rear Left (RL)

Brake Type
DISC

PADS PASS DISC PASS

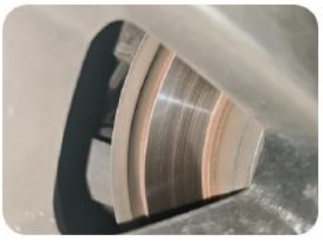

Rear Right (RR)

Brake Type
DISC


PADS PASS DISC PASS



Front Right (FR)

Brake Type
DISC

PADS PASS DISC PASS

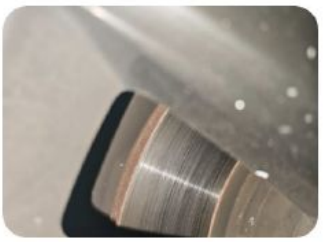

Suspension

4 points checked



Front Suspension

LEFT PASS



RIGHT PASS



Rear Suspension

LEFT PASS




RIGHT PASS



Interior & Exterior

17 points checked

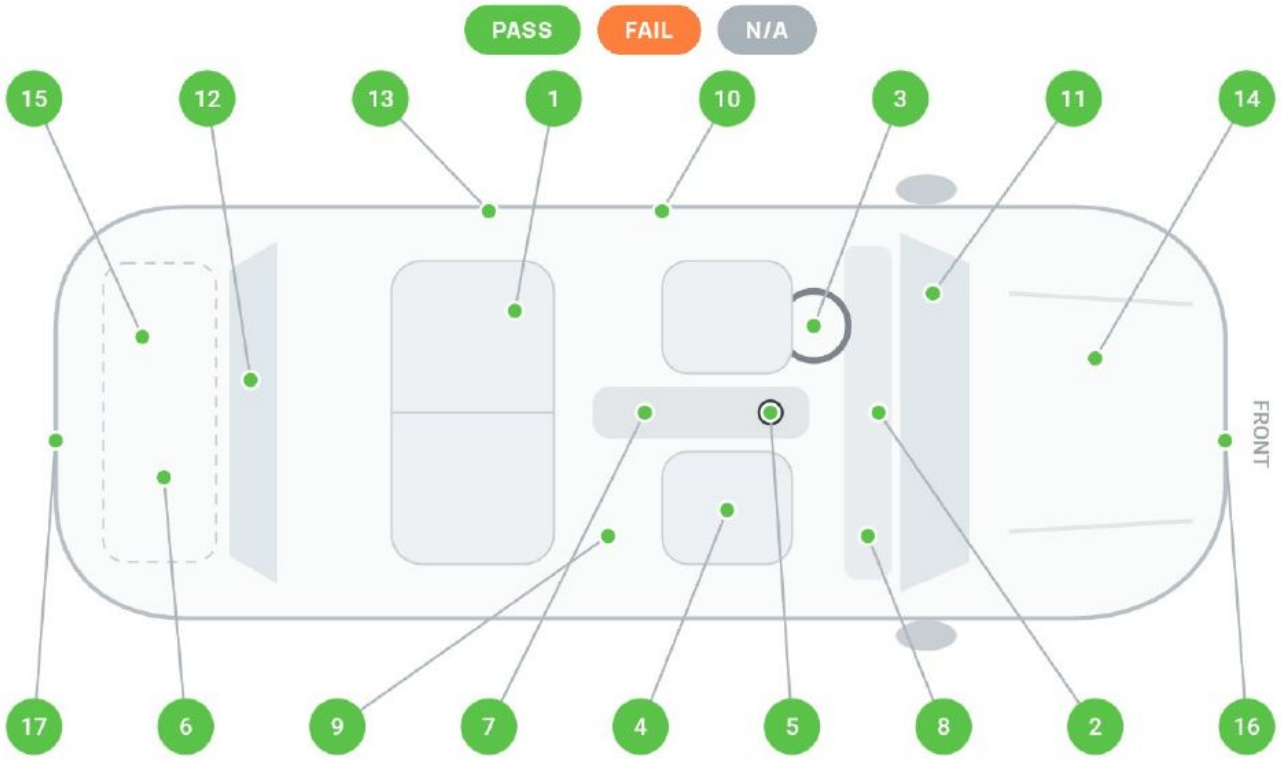

1	Roof Lining	PASS	2	Rear View Mirror	PASS
3	Steering Wheel Upholstery	PASS	4	Seats Upholstery	PASS
5	Gear Lever	PASS	6	Trunk Lining	PASS
7	Armrest & Side Pockets	PASS	8	Dashboard	PASS
9	Floor Mats	PASS	10	Doors	PASS
11	Front Windscreen	PASS	12	Rear Windscreen	PASS

13	Side Windows	PASS	14	Hood	PASS
15	Trunk	PASS	16	Front Bumper	PASS
17	Back Bumper	PASS			


Electrical

29 points checked

Gear Lever PASS	Doors PASS	Rear Windscreen PASS
Steering PASS	Key PASS	Infotainment PASS
Windows Operation PASS	Seats Adjustment PASS	Door Lock PASS
A/C Control & Cooling PASS	Center Console Buttons PASS	Cameras PASS
Gauges PASS	Rear View / Side Mirror PASS	A/C Grilles PASS
Ignition System PASS	Brake Lights PASS	Headlights PASS
Fog Lights PASS	Reverse Lights PASS	Number Plate Lights PASS
Indicators & Hazards PASS	Wipers PASS	Soft Closing Doors PASS
Sunroof / Moonroof PASS	Interior Lights PASS	Cruise Control PASS
Horn PASS	Parking Sensors PASS	

Body & Paint

13 panels checked

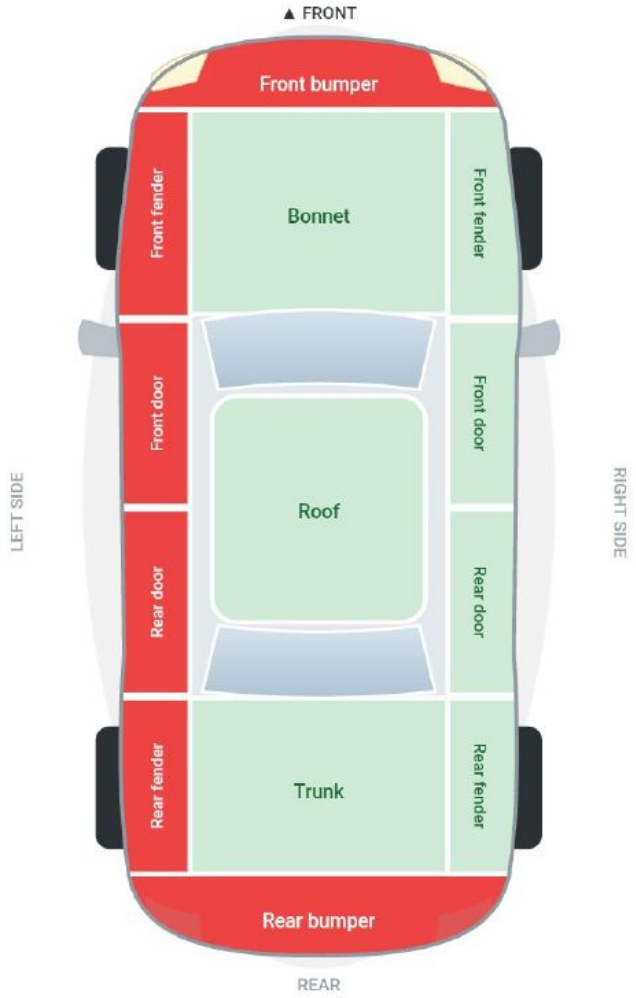

PAINT CONDITION

7 / 13 original

Original	7
Repainted	6
Partly repainted	0
Replaced	0
Damaged	0

Panels with paint / body work

Front bumper	REPAINTED
Rear bumper	REPAINTED
Front left fender	REPAINTED
Front left door	REPAINTED
Rear left door	REPAINTED
Rear left fender	REPAINTED

Engine

17 points checked

Engine Upper Cover PASS	Engine Shield Cover PASS	Engine Mounts PASS
Bonnet Hinge & Holder PASS	Turbo / Supercharger PASS	Fender Liners PASS
Drive Belt / Pulleys PASS	Engine Idle PASS	Engine Oil Filler Cap PASS
Radiator PASS	Engine Oil Leaks PASS	Engine Oil Condition PASS
Coolant Condition PASS	Coolant Cap PASS	Hoses & Pipes PASS

Exhaust System	PASS
4 Wheel Drive	PASS

Transmission

6 points checked


Transmission Fluid Level & Condition PASS	Transmission Fluid Leaks PASS	Gear Selector PASS
Unusual Noise PASS	Gear Shifting PASS	Differential PASS


Diagnostics (OBD Scan)

7 points checked

Engine (ECM) PASS	Transmission (TCM) PASS	ABS / Brakes PASS
Airbags (SRS) PASS	Body Control (BCM) PASS	Emissions Readiness PASS
Battery & Charging PASS		

Engine (ECM) PASS

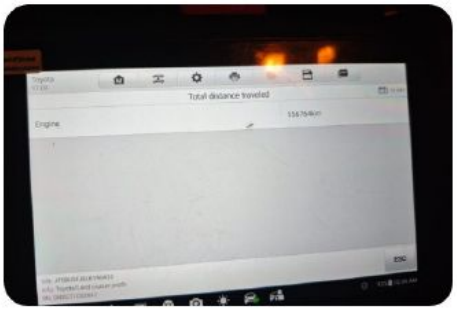

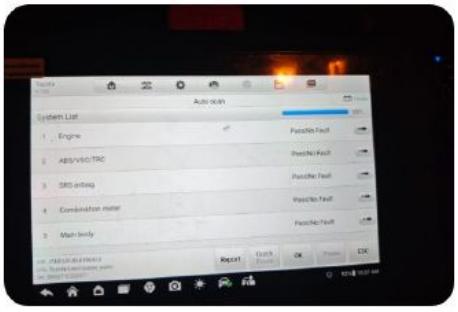

Road Test


10 points checked

Engine Performance PASS	Acceleration PASS	Transmission Shifting PASS
Braking Performance PASS	Steering & Alignment PASS	Suspension Noise PASS
Vibration PASS	Cruise Control PASS	A/C While Driving PASS

Dashboard Warning Lights	PASS

Chassis & Subframe

20 points checked

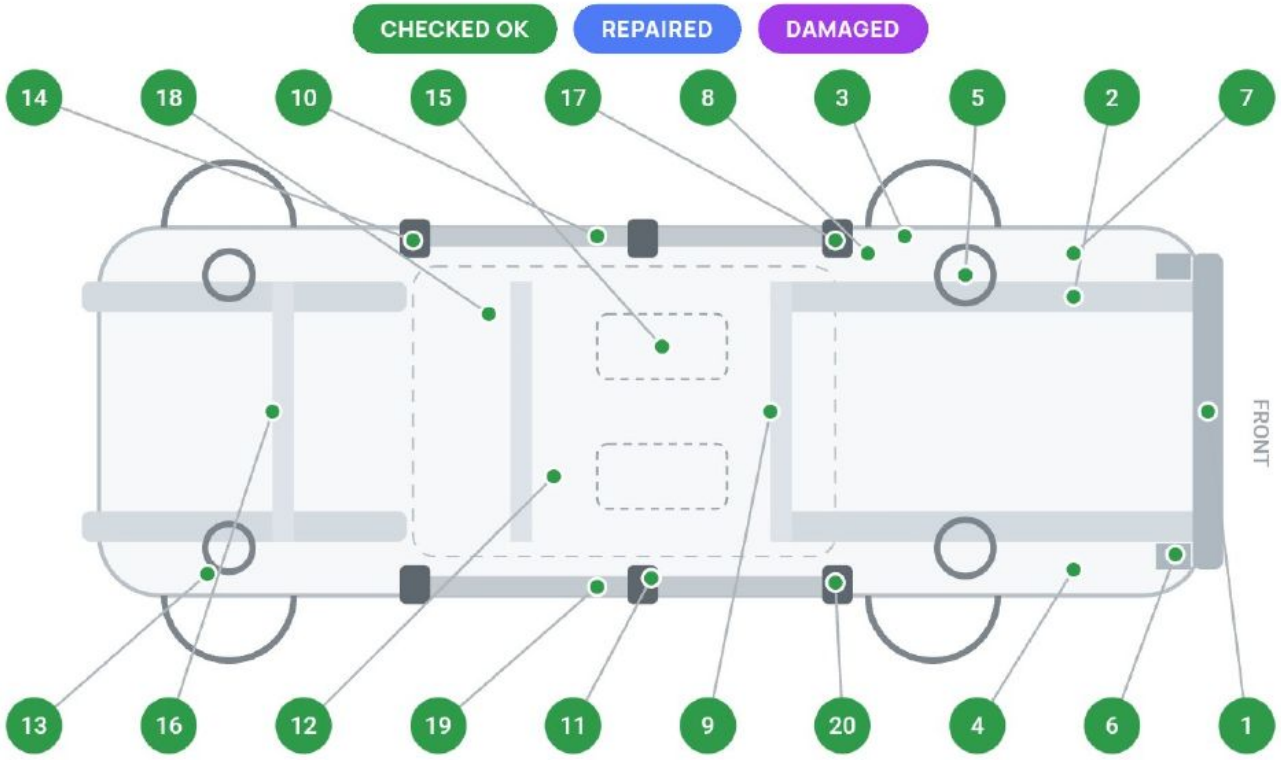


1	Core support	CHECKED OK	2	Frame rail	CHECKED OK
3	Wheel house	CHECKED OK	4	Right fender apron	CHECKED OK
5	Shock tower / shock mount	CHECKED OK	6	Radiator side support	CHECKED OK
7	Left fender apron	CHECKED OK	8	Front body hinge pillar	CHECKED OK
9	Front floor board	CHECKED OK	10	Left door sill	CHECKED OK
11	Center pillar (B pillar)	CHECKED OK	12	Mid floor board	CHECKED OK

13	Body quarter panel	CHECKED OK	14	C pillar	CHECKED OK
15	Seat frame	CHECKED OK	16	Rear floor panel	CHECKED OK
17	Left A pillar	CHECKED OK	18	Roof panel	CHECKED OK
19	Right door sill	CHECKED OK	20	Right A pillar	CHECKED OK


General Photos

Exterior

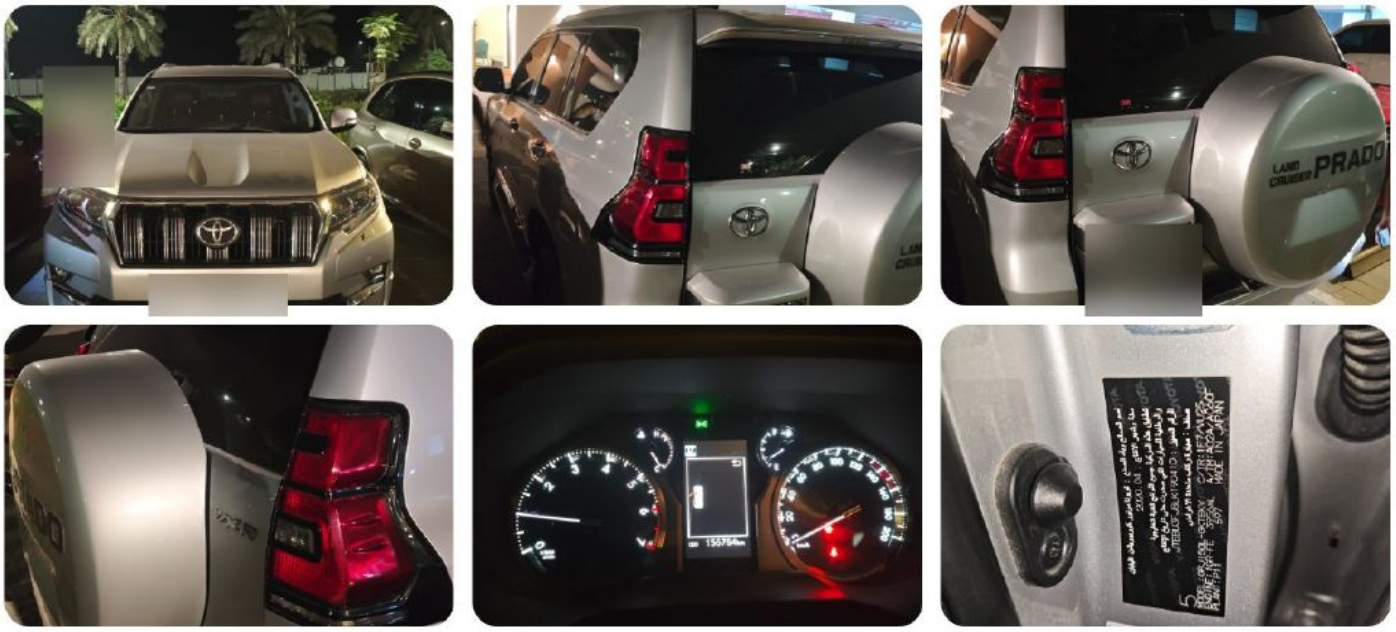





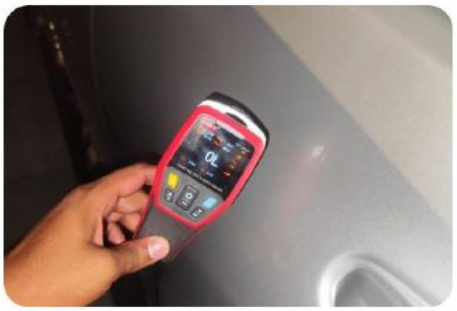

Interior







Engine Bay & Undercarriage







Inspector Comment

Comment

- Left side has accident
- Major service was done recently
- Front bumper: Repainted
- Rear bumper: Repainted
- Front left fender: Repainted
- Front left door: Repainted
- Rear left door: Repainted
- Rear left fender: Repainted

Disclaimer and Liability Policy

1. Inspection Scope

AutoInspect.ae carries out a visual, non-invasive inspection of the vehicle on the date and time shown in this report. No parts are dismantled. The report records the inspector's professional observations at that moment only.

2. No Guarantee of Vehicle Condition

This report is not a warranty or guarantee of the vehicle's present or future condition, roadworthiness or value. Faults that are hidden, intermittent, or only detectable by dismantling parts may not be identified, and results may differ from inspections carried out at another time or with other equipment.

3. Mileage, History and Documents

Odometer reading, service history and ownership details are checked against what is visible and what is provided at the time of inspection. AutoInspect.ae cannot confirm information that was not disclosed, or that was altered before the inspection.

4. Service to the Customer

The inspection is carried out for the customer who ordered it. Any liability of AutoInspect.ae arising from this report is limited to the inspection fee paid by that customer. AutoInspect.ae has no contractual obligation to the seller or to any other party.

5. Seller Acknowledgement

By allowing the inspection, the seller accepts that this report is an independent assessment that may differ from the seller's own description of the vehicle, and agrees not to hold AutoInspect.ae responsible for any dispute between the buyer and the seller about the vehicle or its sale.

6. Report Validity


This report is valid only in its original, unaltered form. It can be checked using the Report ID and QR code shown in it. Any copy that has been edited is not a valid AutoInspect.ae report.

7. Dispute Resolution

Any concern about this report should first be raised with AutoInspect.ae in writing, so it can be resolved in good faith. Disputes that cannot be resolved this way are subject to the laws of the United Arab Emirates and the courts of the Emirate of Dubai.

Thank you for choosing AutoInspect.ae

www.autoinspectuae.com

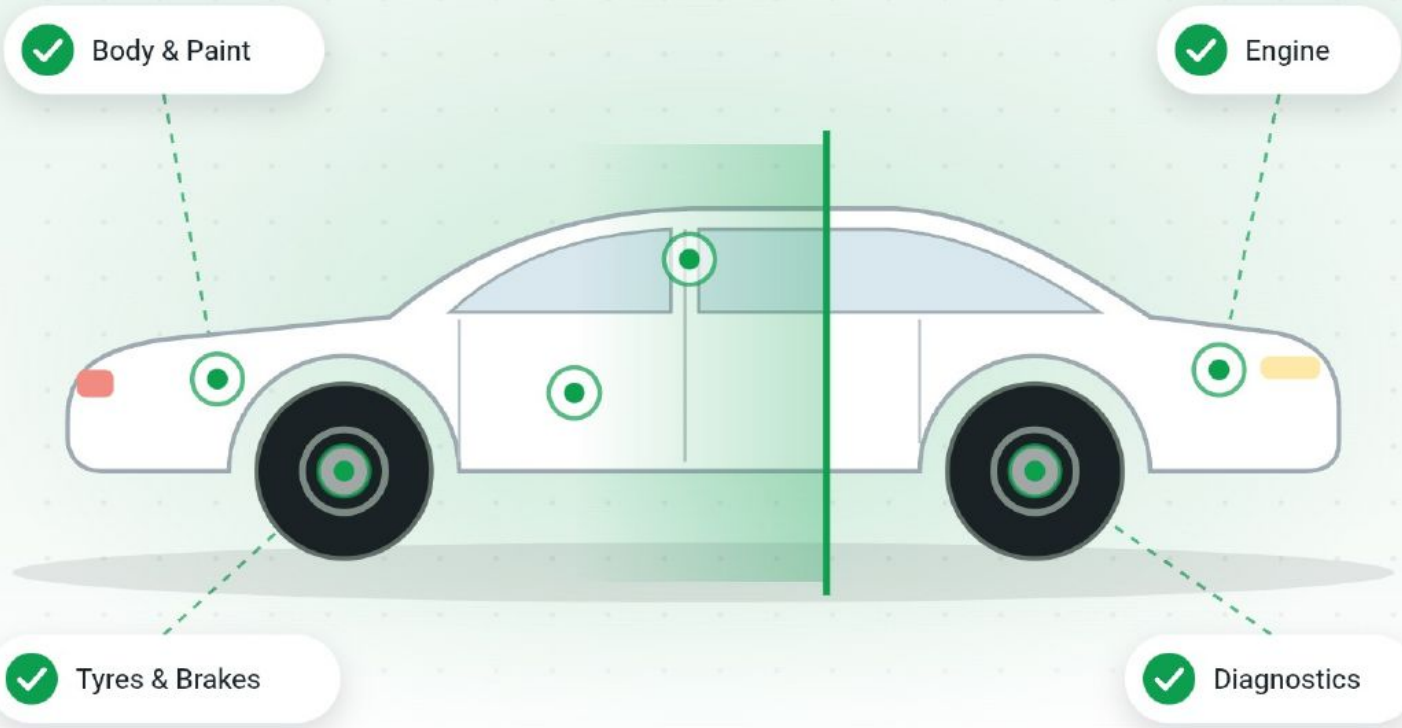

AutoInspect.ae